



## Service Bulletin

**Subject:** Ram HD No-Drill Drag Link Too Long

**Applicable Models:** Any Ram HD equipped with AEV DualSport suspension system

**Condition:** AEV No-drill drag link too long after installing the suspension

**Diag/Repairs:** Certain factory setups have a slightly longer drag link end near the pitman arm. The hex keyed end of the short link can be cut off along with up to 4 threads of the link for extra internal clearance. The adjuster sleeve is internally threaded further than the drag link is, so it can be threaded internally further than what may appear to be possible. If the length of the drag link is off by more than an inch, remove the drag link from the knuckle and thread it in until it is no longer possible to do so, then adjust the length outward from there.